

GPS RWY 35




COLUMBIA (O22)

APP CRS	Rwy Idg	4081
354°	TDZE	2103
	Apt Elev	2118

▽ If local altimeter setting not received, procedure not authorized.
△ NA Circling not authorized east of Rwy 17-35.

MISSED APPROACH: Climbing left turn to 4000 direct HABXU WP and hold.

AWOS-3 124.65	NORCAL APP CON (N) 123.7 338.25 (W) 125.1 363.2	OAKLAND CENTER (E) 126.85 322.55	UNICOM 122.975 (CTAF) 0
-------------------------	---	--	--

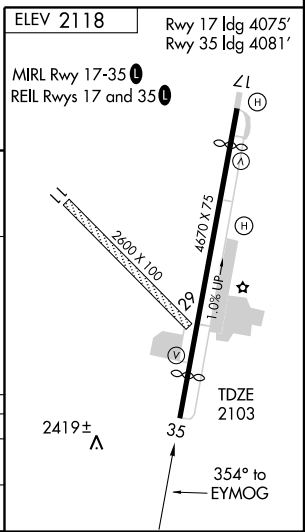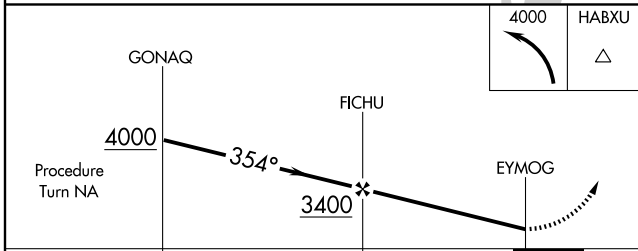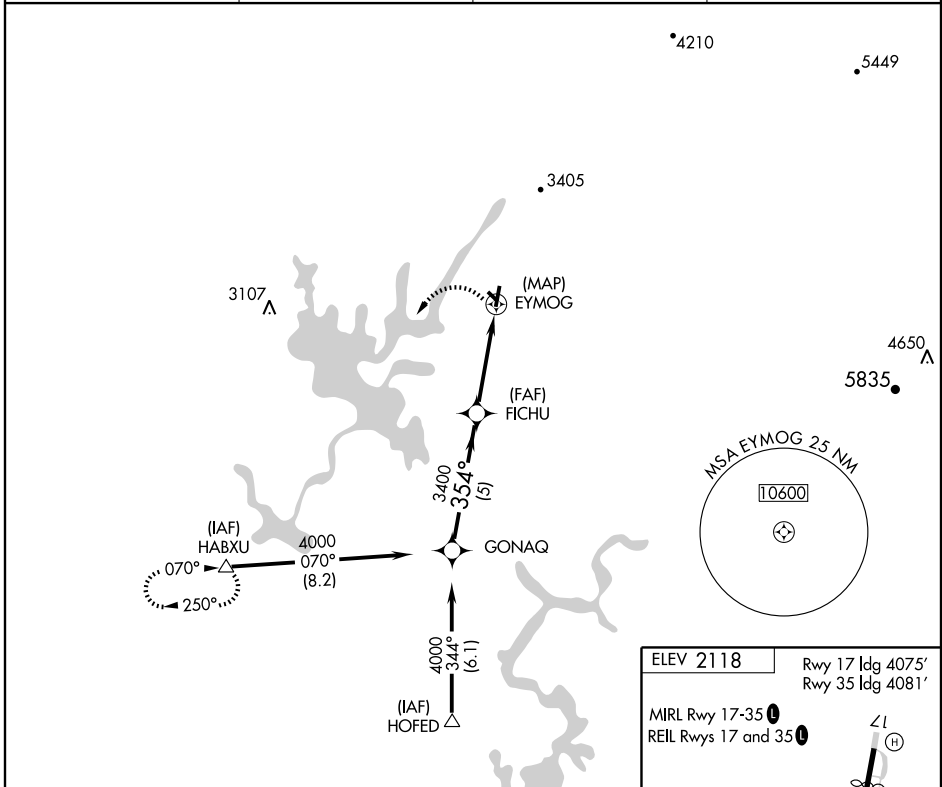

CATEGORY	A	B	C	D
S-35	2800-1	697 (700-1)	2800-2 697 (700-2)	NA
CIRCLING	2800-1 682 (700-1)	2840-1 722 (800-1)	2840-2 722 (800-2)	NA

SW-2, 07 MAY 2009 to 04 JUN 2009

SW-2, 07 MAY 2009 to 04 JUN 2009